File No. HPSLDC/SLDC-55/2022-23
Status of healthiness of Telemetry System installed at SLDC Control Centre, Shimla as on 10.01.2024 at 11:00

| Sr. No. | Description | Total No. | Communication Protocol | | Speech | Non-Reporting | | |
|---------|--------------------------|--------------|---------------------------|-------------------|---|---------------|---------|-------|
| | | | IEC 101 | IEC 104 | Оресси | IEC 101 | IEC 104 | Total |
| Α | IPP's | 48 | 4 | 44 | Speech is not available due to non functioning of PUNCOM exchange and ORANGE exchange is yet to be interfaced with various RTU locations by HPSEBL. | 1 | 12 | 13 |
| В | HPPCL Stations | 4 | 1 | 3 | | 1 | 0 | 1 |
| | Open Access Consumers | 9 | 1 | 8 | | 1 | 1 | 2 |
| D | HPPTCL Stations | 13 | 1 | 12 | | 0 | 0 | 0 |
| ۰E | HPSEB Stations | 51 | 11 | 40 | | 3 | 4 | 7 |
| F | URTDSM | 1 | 0 | 1 | | 0 | 0 | 0 |
| | Grand Total | 126 | 18 | 108 | | 6 | 17 | 23 |
| | Status | | | ecordir S & Co | Remarks | | | |
| - | SCADA Hardware | | | | OK | | | |
| | EMS (Energy Man | | | | OK | | | |
| | IMM (Information N | | | | Ok | | | |
| | e-DNA (enterprise | Distributed | Network Are | chitecture) | OK | | | |
| | Web Reporting | | | | Ok | | | |
| | UI Server (User Int | | | | OK | | | |
| vii | ICCP Link (Inter ce | entre Contro | l Protocol) | | OK | | | |

Entity-Wise Abstract (Non Reporting of Data)

| Sr. No. | | Comn | nunication | | Reason for Non Reporting | |
|----------------|--|--|---|--|---|--|
| | Description | Protocol | Media | Remarks | | |
| Α | IPP's | 1 - 1 - 1 - 1 - 1 | | | | |
| 1 | Brua SHEP (9 MW) | IEC 104 | GPRS | Not Reporting since 18.11.2022 | Switchyard partially damaged by flash flood. System is under maintenance. | |
| 2 | Sarwari-III SHEP(2 MW) | IEC 104 | GPRS | Not Reporting since 23.07.2022 | 07 Nos letter are already written for rectification. | |
| 3 | Satya Sai Hydro(3.8 MW) | IEC 104 | GPRS | Not Reporting since 27.09.2021 | 06 Nos letter are already written for rectification. | |
| 4 | Siunr SHEP(2 MW) | IEC 104 | 104 GPRS Not Reporting since 23.07.2021 | | 06 Nos letter are already written for rectification. | |
| 5 | 220/132 kV Chaur | IEC 101 | PLCC/OPGW | Not Reporting since 07.04.2022 | PLCC Modem issue, 06 Nos. letter are already writen to M/s Everest Power f rectification | |
| 6 | Patikari HEP(16 MW) | | | Not Reporting since 16.08.2023 | Power House sub-merged in flash food due to heavy rain in monsoon season | |
| 7 | KK Kashyap Solar PP (5 MW) | IEC 104 | GPRS | Not Reporting since 03.10.2023 | BSNL fibre disconnected, hence BSNL lease line not working. | |
| 8 | GR Enterprises Solar PP (1 MW) | 1.95 MW) IEC 104 GPRS Not Reporting since 28.12.20 MW) IEC 104 GPRS Not Reporting since 26.12.20 | | Not Reporting since 16.10.2023 | RTU not functioning properly matter has been taken-up by Entity with OEM. Matter Taken up with the Gateway vendor for rectification. | |
| 9 | Beas Kund Top (4.95 MW) | | | Not Reporting since 28.12.2023 | | |
| 10 | Ikshvaku Solar (1 MW) | | | Not Reporting since 26.12.2023 | | |
| 11 | Chandel Solar (0.5 MW) | IEC 104 | GPRS | Not Reporting Since18.12.2023 | | |
| 12 | Kota Gad SHEP (3.5 MW) | IEC 104 | GPRS | Not Reporting since 30.11.2023 | Internet payment not done by entity. | |
| 13 B | 13 Selti Musrung (24 MW) IEC 104 GPRS Not Reporting since 25.04.2023 F HPPCL Stations | | | | Power House sub-merged in flash food due to heavy rain in monsoon. | |
| | Berra Dol Solar (5 MW) | IEC 101 | GPRS | Not Reporting since 28.11.2023 | HPPCL has takenup the issue with AMC vender for identifying and rectifying the fault. | |
| 1 | | IEC 101 | GPRS | Not Reporting since 28.11.2023 | | |
| С | Open Access Consumers | | | | | |
| 1 | 66 kV Birla Textile, Baddi | IEC 104 | GPRS | Not Reporting Since 13.12.2023 | | |
| 2 | 132 kV Ultc, Bagga | IEC 101 | PLCC | Not Reporting Since 18.10.2023 | RTU and modem not functiong properly | |
| E | HPSEBL Substations | | | | | |
| 1 | 132 kV Baga | IEC 101 | PLCC | Not Reporting Since 17.10.2023 | RTU and modem not functiong properly | |
| 2 | 66 kV Davni | IEC 104 | OPGW | Not Reporting since 29.08.2023 | RTU configration is pending at HPSEBL end. | |
| 3 | Larji (126 MW) | IEC 101 | OPGW | Not Reporting since 10.07.2023 | The telemetry equipments of both Larji HEP is completely damaged due to submergence in muddy water by heavy flood on 09.07.2023 & 10.07.2023. | |
| 4 | 220 KV Bhaba | IEC 101 | PLCC | Not Reporting today 10.01.2024 | | |
| 5 | Rakkar (Una)(195 MW) | IEC 104 | OPGW | Not Reporting Since 01.01.2024 | | |
| 6 | Baner (GS) (12 MW) | IEC 104 | GPRS | Not Reporting since 25.09.2023 | The Real-time data of Baner (GS) remains intermittent due to weak signal of Airtel & Ethernet port issues in Motorola make MBCS Ace 3600 RTU. | |
| 7 | Chaba (GS) (1.75 MW) IEC 104 GPRS | | Not Reporting since 18.09.2023 | The telemetry equipments of Chaba (GS) is completely damaged due to submergence in muddy water by heavy flood on 10.07.2023. | | |

Junior Engineer (SCADA)

10/1/24 Siemens Site Engineer

Assistant Engineer (SCADA)

Dated. 10.01.2024

Sr, Executive Engineer (SCADA), HP State Load Despatch Centre, Govt. of HP, SLDC Complex, Totu, Shimla-11.